



Center Console Lifts Up in the Back

SYMPTOM

The center console lifts up in the back.

PROBABLE CAUSE

The padding for the center floor mat pushes up the back of the center console.

CORRECTIVE ACTION

Cut the center floor mat where the center console ribs touch, and stick 35 mm squares of wool felt over the ribs.

REQUIRED MATERIALS

Wool Felt: P/N 06993-SA5-000, H/C 2086676
(One roll fixes 30 vehicles.)

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 843007

Flat Rate Time: 0.2 hour

Failed Part: P/N 83301-S2A-A02ZA
H/C 6856496

Defect Code: 007

Contention Code: A99

Template ID: 03-012A

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Lift the center console from the center tunnel (eight clips). Leave the shift lever knob in place and the switch connectors plugged in.
2. Find the area on the center floor mat where the center console ribs touch.

INDENTATIONS IN CENTER FLOOR MAT




3. Where the ribs touch, use a razor blade or utility knife to cut out the center floor mat, as shown.

Cut out the center floor mat.



CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

4. Cut two 35 mm x 35 mm pieces of wool felt. Stick them over the ribs.

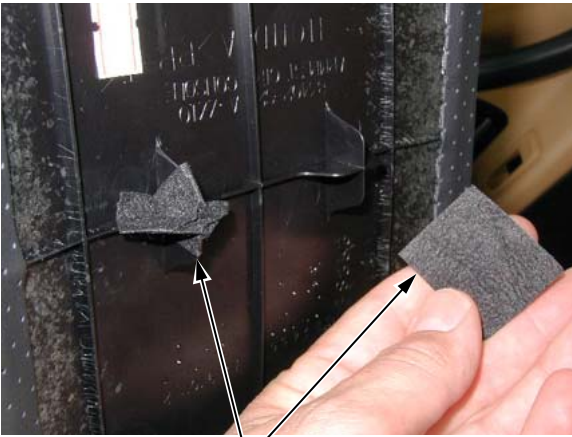

WOOL FELT

5. Reinstall the center console.